

MCP120/130

Microcontroller Supervisory Circuit with Open Drain Output


FEATURES

- Holds microcontroller in reset until supply voltage reaches stable operating level
- · Resets microcontroller during power loss
- Precision monitoring of 3V, 3.3V and 5V systems
- 7 voltage trip points available
- Active low RESET pin
- Open drain output
- Internal pull-up resistor (5 k Ω) for MCP130
- Holds RESET for 350 ms (typical)
- RESET to Vcc = 1.0V
- Accuracy of ±125 mV for 5V systems and ±75 mV for 3V systems over temperature
- 45 μA typical operating current
- Temperature range:
 - Industrial (I): -40°C to +85°C


DESCRIPTION

The Microchip Technology Inc. MCP120/130 is a voltage supervisory device designed to keep a microcontroller in reset until the system voltage has reached the proper level and stabilized. It also operates as protection from brown-out conditions when the supply voltage drops below a safe operating level. Both devices are available with a choice of seven different trip voltages and both have open drain outputs. The MCP130 has an internal 5 k\Omega pullup resistor. Both devices have active low RESET pins. The MCP120/130 will assert the RESET signal whenever the voltage on the VDD pin is below the trip-point voltage.

PACKAGES

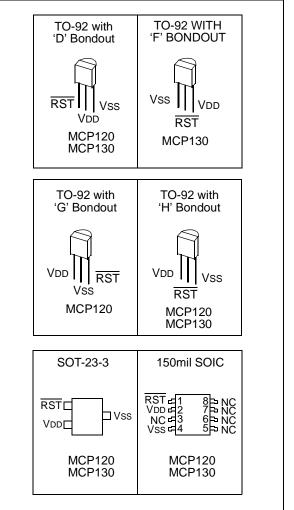

BLOCK DIAGRAM

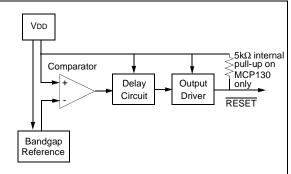

1.0 ELECTRICAL CHARACTERISTICS

1.1 Maximum Ratings*

VDD
All inputs and outputs w.r.t. Vss0.6V to VDD +1.0V
Storage temperature65°C to +150°C
Ambient temp. with power applied65°C to +125°C
ESD protection on all pins $\ge 2 \text{ kV}$

DC AND AC CHARACTERISTICS

*Notice: Stresses above those listed under "Maximum Ratings" may cause permanent damage to the device. This is a stress rating only and functional operation of the device at those or any other conditions above those indicated in the operational listings of this specification is not implied. Exposure to maximum rating conditions for extended periods may affect device reliability.

All parameters apply at the specified temp and voltage ranges unless otherwise noted.		VDD = 1.0 - Industrial (I		+85°C			
Parameter		Symbol	Min.	Тур.	Max.	Units	Test Conditions
Operating Voltage Range		Vdd	1.0	_	5.5	V	
VDD Value to RE	SET	Vdd _{min}	1.0	_		V	
Operating Curre	nt	Idd	_	45	60	μΑ	VDD = 5.5V (no load)
VDD Trip Point	MCP1X0-270 MCP1X0-300 MCP1X0-315 MCP1X0-450 MCP1X0-460 MCP1X0-475 MCP1X0-485	Vtrip	2.55 2.85 3.0 4.25 4.35 4.50 4.60	2.625 2.925 3.075 4.375 4.475 4.625 4.725	2.7 3.0 3.15 4.50 4.60 4.75 4.85	V	
RESET Low Level Output Voltage	MCP1X0-270 MCP1X0-300 MCP1X0-315	Vol	_		0.4	V	IOL = 3.2 mA, VDD = VTRIP _{MIN}
	MCP1X0-450 MCP1X0-460 MCP1X0-475 MCP1X0-485		_		0.6		IOL = 8.5 mA, VDD = VTRIP _{MIN}
RESET High Level Output Voltage (MCP130 Only)	MCP130-xxx (All Vtrip Points)	Vон	VDD-0.7			V	IOH = 50 μ A,VDD > VTRIP _{MAX}
Pull-up Resistor	(MCP130 Only)		—	5	—	kΩ	
Output Leakage	(MCP120 Only)		—	1	—	μΑ	
Threshold Hyste	eresis	VHYS	—	50	_	mV	
VDD Detect to RESET Inactive		tRPU	150	350	700	ms	
VDD Detect to RESET		tRPD	_	10	_	μs	VDD ramped from VTRIP _{MAX +} 250 mV down to VTRIP _{MIN} - 250 mV
Note: Typic	al values are for 2	25°C and VD	D = 5.0V				·

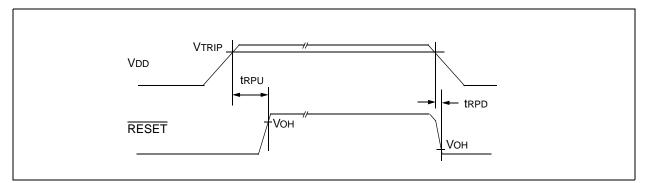


Figure 1-1: MCP120/130 Timing Diagram

2.0 APPLICATIONS INFORMATION

2.1 The Need for Supervisory Circuits

For many of today's microcontroller applications, care must be taken to prevent low power conditions that can cause many different system problems. The most common causes are brown-out conditions where the system supply drops below the operating level momentarily, and the second, is when a slowly decaying power supply causes the microcontroller to begin executing instructions without enough voltage to sustain SRAM and producing indeterminate results.

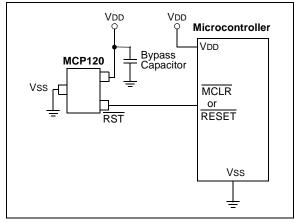


Figure 2-1: Typical Application

2.2 Negative Going VDD Transients

Many system designers implementing POR circuits are concerned about the minimum pulse width required to cause a reset. Figure 2-2 shows typical transient voltage below the trip point (VTRIP - VDD) vs. transient duration. It shows that the farther below the trip point the transient pulse goes, the duration of the pulse required to cause a reset gets shorter. A 0.1 μ F bypass cap mounted as close as possible to the VDD pin provides additional transient immunity.

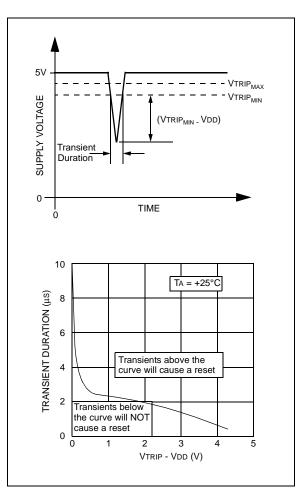


Figure 2-2: Typical Transient Response

2.3 Effect of Temperature on Timeout Period (tRPU)

The timeout period (tRPU) determines how long the device remains in the reset condition. This is controlled by an internal RC timer and is effected by both VDD and temperature. The graph shown in Figure 2-3 shows typical response for different VDD values and temperatures.

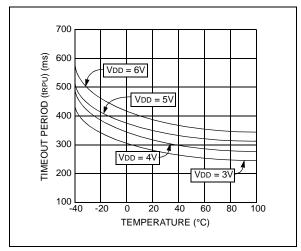


Figure 2-3: tRPU vs. Temperature

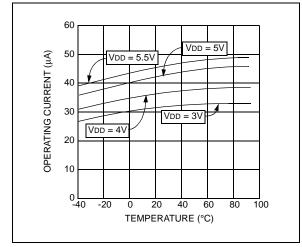


Figure 2-4: IDD vs. Temperature

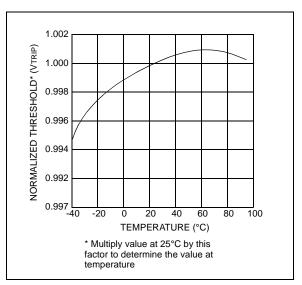
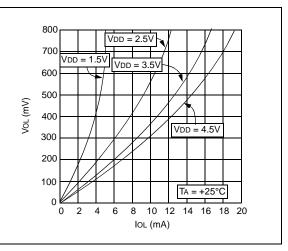


Figure 2-5: Normalized VTRIP vs. Temperature






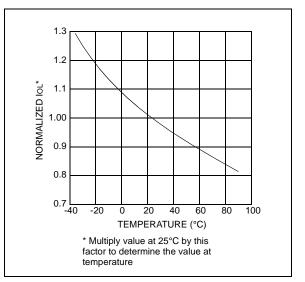


Figure 2-7: Normalized IOL vs. Temperature

3.0 PACKAGING INFORMATION

3.1 Package Marking Information


3-Lead Plastic Transistor Outline (TO-92)




8-Lead Plastic Small Outline (SOIC)



3-Lead Plastic Small Outline Transistor (SOT23)




Example:



Example:



Example:



SOT23 PARTS LABELING:

The table below identifies the first 2 characters (XX) in the 4-character field (XXNN) for marking of the 3-Lead SOT23 package.


Mark	Part Number	Mark	Part Number
SJ	MCP120T-270I/TT	PJ	MCP130T-270I/TT
SK	MCP120T-300I/TT	PK	MCP130T-300I/TT
SL	MCP120T-315I/TT	PL	MCP130T-315I/TT
SM	MCP120T-450I/TT	PM	MCP130T-450I/TT
SN	MCP120T-460I/TT	PN	MCP130T-460I/TT
SO	MCP120T-475I/TT	PO	MCP130T-475I/TT
SP	MCP120T-485I/TT	PP	MCP130T-485I/TT

Legend	: XXX YY WW NNN	Customer specific information* Year code (last 2 digits of calendar year) Week code (week of January 1 is week '01') Alphanumeric traceability code
	be carried	nt the full Microchip part number cannot be marked on one line, it will over to the next line thus limiting the number of available characters her specific information.

* Standard OTP marking consists of Microchip part number, year code, week code, and traceability code. For OTP marking beyond this, certain price adders apply. Please check with your Microchip Sales Office. For QTP devices, any special marking adders are included in QTP price.

3.2 Package Detail Information

3-Lead Plastic Transistor Outline (TO) (TO-92)

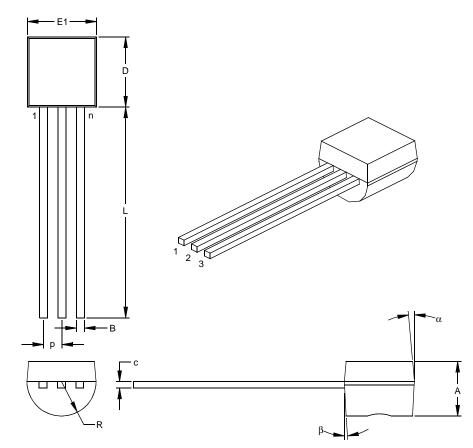

	Units	INCHES*			MILLIMETERS		
Dimension	n Limits	MIN	NOM	MAX	MIN	NOM	MAX
Number of Pins	n		3			3	
Pitch	р		.050			1.27	
Bottom to Package Flat	А	.130	.143	.155	3.30	3.62	3.94
Overall Width	E1	.175	.186	.195	4.45	4.71	4.95
Overall Length	D	.170	.183	.195	4.32	4.64	4.95
Molded Package Radius	R	.085	.090	.095	2.16	2.29	2.41
Tip to Seating Plane	L	.500	.555	.610	12.70	14.10	15.49
Lead Thickness	С	.014	.017	.020	0.36	0.43	0.51
Lead Width	В	.016	.019	.022	0.41	0.48	0.56
Mold Draft Angle Top	α	4	5	6	4	5	6
Mold Draft Angle Bottom	β	2	3	4	2	3	4


*Controlling Parameter


Notes:


Dimensions D and E1 do not include mold flash or protrusions. Mold flash or protrusions shall not exceed .010" (0.254mm) per side. JEDEC Equivalent: TO-92


Drawing No. C04-101


3-Lead Plastic Small Outline Transistor (TT) (SOT23)

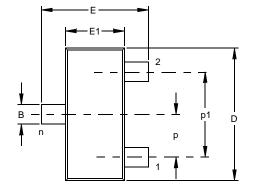

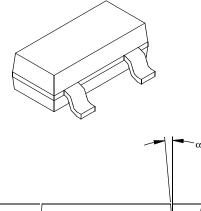








	Units	INCHES*			N	8	
Dimension Limits		MIN NOM MAX		MIN	NOM	MAX	
Number of Pins	n		3			3	
Pitch	р		.038			0.96	
Outside lead pitch (basic)	p1		.076			1.92	
Overall Height	А	.035	.040	.044	0.89	1.01	1.12
Molded Package Thickness	A2	.035	.037	.040	0.88	0.95	1.02
Standoff §	A1	.000	.002	.004	0.01	0.06	0.10
Overall Width	Е	.083	.093	.104	2.10	2.37	2.64
Molded Package Width	E1	.047	.051	.055	1.20	1.30	1.40
Overall Length	D	.110	.115	.120	2.80	2.92	3.04
Foot Length	L	.014	.018	.022	0.35	0.45	0.55
Foot Angle	φ	0	5	10	0	5	10
Lead Thickness	С	.004	.006	.007	0.09	0.14	0.18
Lead Width	В	.015	.017	.020	0.37	0.44	0.51
Mold Draft Angle Top	α	0	5	10	0	5	10
Mold Draft Angle Bottom	β	0	5	10	0	5	10


* Controlling Parameter § Significant Characteristic


Notes:


Dimensions D and E1 do not include mold flash or protrusions. Mold flash or protrusions shall not exceed .010" (0.254mm) per side. JEDEC Equivalent: TO-236 Drawing No. C04-104

8-Lead Plastic Small Outline (SN) - Narrow, 150 mil (SOIC

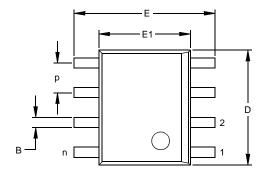

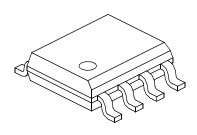

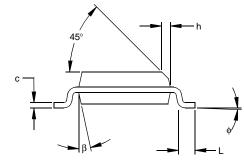

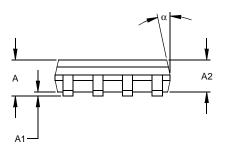

	Units	Units INCHES*			MILLIMETERS			
Dimensio	on Limits	MIN	NOM	MAX	MIN	NOM	MAX	
Number of Pins	n		8			8		
Pitch	р		.050			1.27		
Overall Height	Α	.053	.061	.069	1.35	1.55	1.75	
Molded Package Thickness	A2	.052	.056	.061	1.32	1.42	1.55	
Standoff §	A1	.004	.007	.010	0.10	0.18	0.25	
Overall Width	Е	.228	.237	.244	5.79	6.02	6.20	
Molded Package Width	E1	.146	.154	.157	3.71	3.91	3.99	
Overall Length	D	.189	.193	.197	4.80	4.90	5.00	
Chamfer Distance	h	.010	.015	.020	0.25	0.38	0.51	
Foot Length	L	.019	.025	.030	0.48	0.62	0.76	
Foot Angle	¢	0	4	8	0	4	8	
Lead Thickness	С	.008	.009	.010	0.20	0.23	0.25	
Lead Width	В	.013	.017	.020	0.33	0.42	0.51	
Mold Draft Angle Top	α	0	12	15	0	12	15	
Mold Draft Angle Bottom	β	0	12	15	0	12	15	

* Controlling Parameter § Significant Characteristic

Notes:

Dimensions D and E1 do not include mold flash or protrusions. Mold flash or protrusions shall not exceed .010" (0.254mm) per side. JEDEC Equivalent: MS-012 Drawing No. C04-057

ON-LINE SUPPORT

Microchip provides on-line support on the Microchip World Wide Web (WWW) site.

The web site is used by Microchip as a means to make files and information easily available to customers. To view the site, the user must have access to the Internet and a web browser, such as Netscape or Microsoft Explorer. Files are also available for FTP download from our FTP site.

Connecting to the Microchip Internet Web Site

The Microchip web site is available by using your favorite Internet browser to attach to:

www.microchip.com

The file transfer site is available by using an FTP service to connect to:

ftp://ftp.microchip.com

The web site and file transfer site provide a variety of services. Users may download files for the latest Development Tools, Data Sheets, Application Notes, User's Guides, Articles and Sample Programs. A variety of Microchip specific business information is also available, including listings of Microchip sales offices, distributors and factory representatives. Other data available for consideration is:

- Latest Microchip Press Releases
- Technical Support Section with Frequently Asked Questions
- Design Tips
- Device Errata
- Job Postings
- Microchip Consultant Program Member Listing
- Links to other useful web sites related to Microchip Products
- Conferences for products, Development Systems, technical information and more
- · Listing of seminars and events

Systems Information and Upgrade Hot Line

The Systems Information and Upgrade Line provides system users a listing of the latest versions of all of Microchip's development systems software products. Plus, this line provides information on how customers can receive any currently available upgrade kits.The Hot Line Numbers are:

1-800-755-2345 for U.S. and most of Canada, and

1-480-792-7302 for the rest of the world.

READER RESPONSE

It is our intention to provide you with the best documentation possible to ensure successful use of your Microchip product. If you wish to provide your comments on organization, clarity, subject matter, and ways in which our documentation can better serve you, please FAX your comments to the Technical Publications Manager at (480) 792-7578.

Please list the following information, and use this outline to provide us with your comments about this Data Sheet.

To:	Technical Publications Manager	Total Pages Sent
RE	: Reader Response	
Fro	m: Name	
	Company	
	Address	
	City / State / ZIP / Country	
	Telephone: ()	FAX: ()
Арр	plication (optional):	
Wo	uld you like a reply?YN	
Dev	vice: MCP120/130 Literature Number: D	S11184D
Que	estions:	
1.	What are the best features of this document?	
2.	How does this document meet your hardware and soft	vare development needs?
3.	Do you find the organization of this data sheet easy to	follow? If not, why?
4.	What additions to the data sheet do you think would en	hance the structure and subject?
5.	What deletions from the data sheet could be made with	out affecting the overall usefulness?
6.	Is there any incorrect or misleading information (what a	nd where)?
7.	How would you improve this document?	
8.	How would you improve our software, systems, and sili	con products?

MCP120/130

NOTES:

2

NOTES:

PRODUCT IDENTIFICATION SYSTEM

To order or to obtain information (e.g., on pricing or delivery), please refer to the factory or the listed sales offices.

PART NO. X Device RESE RESE VTRII Voltac	ET Optic P	X out Temperature on Range	/XX Package	Exa a) b)	2.70V, Industrial Terr	VTRIP range of 2.55V - Ip., SOIC package = VTRIP range of 2.85V -
Device: RESET/RESET VTRIP Voltage Bondout Option:	MCP120: MCP120T: MCP130: MCP130T: MCP130T: 270 = 300 = 315 = 450 = 450 = 450 = 460 = 475 = 485 = D =	Supervisor circuit w (tape & reel) Supervisor circuit w internal pull-up resis	ith open drain output and stor (tape & reel)	c) d) e) f)	TO-92 package MCP120T-315I/TT = 3.15V, Industrial Tem MCP130-450I/SN = 4.50V, Industrial Tem MCP130-460FI/TO = 4.60V, Bonding Opti TO-92 package MCP130T-475I/TT	VTRIP range of 4.25V -
(TO-92 Only) Temperature Range:	F = G = H =	F Bond Option G Bond Option H Bond Option -40°C to +85°C (only	offered in I)		RST VDD VDD MCP120 MCP130	Vss RST MCP130
Package:	SN = TO = TT =	SOIC (8-lead, 150 TO-92 (3-lead) [offe SOT-23 (3-lead) [of			TO-92 with 'G' Bondout	TO-92 with 'H' Bondout
					VDD VSS MCP120	VDD RST MCP120 MCP130

Sales and Support

Data Sheets

Products supported by a preliminary Data Sheet may have an errata sheet describing minor operational differences and recommended workarounds. To determine if an errata sheet exists for a particular device, please contact one of the following:

- 1. Your local Microchip sales office
- 2. The Microchip Corporate Literature Center U.S. FAX: (480) 792-7277
- 3. The Microchip Worldwide Site (www.microchip.com)

Please specify which device, revision of silicon and Data Sheet (include Literature #) you are using.

New Customer Notification System

Register on our web site (www.microchip.com/cn) to receive the most current information on our products.

"All rights reserved. Copyright © 2001, Microchip Technology Incorporated, USA. Information contained in this publication regarding device applications and the like is intended through suggestion only and may be superseded by updates. No representation or warranty is given and no liability is assumed by Microchip Technology Incorporated with respect to the accuracy or use of such information, or infringement of patents or other intellectual property rights arising from such use or otherwise. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, under any intellectual property rights. The Microchip logo and name are registered trademarks of Microchip Technology Inc. in the U.S.A. and other countries. All rights reserved. All other trademarks mentioned herein are the property of their respective companies. No licenses are conveyed, implicitly or otherwise, under any intellectual property rights."

Trademarks

The Microchip name, logo, PIC, PICmicro, PICMASTER, PICSTART, PRO MATE, KEELOQ, SEEVAL, MPLAB and The Embedded Control Solutions Company are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

Total Endurance, ICSP, In-Circuit Serial Programming, FilterLab, MXDEV, microID, FlexROM, fuzzyLAB, MPASM, MPLINK, MPLIB, PICDEM, ICEPIC, Migratable Memory, FanSense, ECONOMONITOR, SelectMode and microPort are trademarks of Microchip Technology Incorporated in the U.S.A.

Serialized Quick Term Programming (SQTP) is a service mark of Microchip Technology Incorporated in the U.S.A.

All other trademarks mentioned herein are property of their respective companies.

© 2001, Microchip Technology Incorporated, Printed in the U.S.A., All Rights Reserved.



Microchip received QS-9000 quality system certification for its worldwide headquarters, design and wafer fabrication facilities in Chandler and Tempe, Arizona in July 1999. The Company's quality system processes and procedures are QS-9000 compliant for its PICmicro® 8-bit MCUs, KEELOQ® code hopping devices, Serial EEPROMs and microperipheral products. In addition, Microchip's quality system for the design and manufacture of development systems is ISO 9001 certified.



WORLDWIDE SALES AND SERVICE

AMERICAS

Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: 480-792-7627 Web Address: http://www.microchip.com

Rocky Mountain 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7966 Fax: 480-792-7456

Atlanta 500 Sugar Mill Road, Suite 200B Atlanta, GA 30350 Tel: 770-640-0034 Fax: 770-640-0307

Austin Applog Broduct Splos

Analog Product Sales 8303 MoPac Expressway North Suite A-201 Austin, TX 78759

Tel: 512-345-2030 Fax: 512-345-6085 Boston

2 Lan Drive, Suite 120 Westford, MA 01886 Tel: 978-692-3848 Fax: 978-692-3821

Boston Analog Product Sales Unit A-8-1 Millbrook Tarry Condominium 97 Lowell Road Concord, MA 01742

Tel: 978-371-6400 Fax: 978-371-0050 Chicago

333 Pierce Road, Suite 180 Itasca, IL 60143 Tel: 630-285-0071 Fax: 630-285-0075

Tel: 630-285-0071 Fax: 630-285 Dallas

4570 Westgrove Drive, Suite 160 Addison, TX 75001 Tel: 972-818-7423 Fax: 972-818-2924

Dayton Two Prestige Place, Suite 130 Miamisburg, OH 45342 Tel: 937-291-1654 Fax: 937-291-9175

Tel: 937-291-1654 Fax: 937-291-9175 **Detroit**

Tri-Atria Office Building 32255 Northwestern Highway, Suite 190 Farmington Hills, MI 48334 Tel: 248-538-2250 Fax: 248-538-2260

Los Angeles

18201 Von Karman, Suite 1090 Irvine, CA 92612 Tel: 949-263-1888 Fax: 949-263-1338

Mountain View

Analog Product Sales 1300 Terra Bella Avenue Mountain View, CA 94043-1836 Tel: 650-968-9241 Fax: 650-967-1590 New York

150 Motor Parkway, Suite 202 Hauppauge, NY 11788 Tel: 631-273-5305 Fax: 631-273-5335 **San Jose** Microchip Technology Inc. 2107 North First Street, Suite 590 San Jose, CA 95131 Tel: 408-436-7950 Fax: 408-436-7955 **Toronto** 6285 Northam Drive, Suite 108 Mississauga, Ontario L4V 1X5, Canada Tel: 905-673-0699 Fax: 905-673-6509

ASIA/PACIFIC

Australia

Microchip Technology Australia Pty Ltd Suite 22, 41 Rawson Street Epping 2121, NSW Australia Tel: 61-2-9868-6733 Fax: 61-2-9868-6755 China - Beijing Microchip Technology Beijing Office Unit 915 New China Hong Kong Manhattan Bldg. No. 6 Chaoyangmen Beidajie Beijing, 100027, No. China Tel: 86-10-85282100 Fax: 86-10-85282104 China - Shanghai Microchip Technology Shanghai Office Room 701, Bldg. B Far East International Plaza No. 317 Xian Xia Road Shanghai, 200051 Tel: 86-21-6275-5700 Fax: 86-21-6275-5060 Hong Kong Microchip Asia Pacific RM 2101, Tower 2, Metroplaza 223 Hing Fong Road Kwai Fong, N.T., Hong Kong Tel: 852-2401-1200 Fax: 852-2401-3431 India Microchip Technology Inc. India Liaison Office **Divyasree Chambers** 1 Floor, Wing A (A3/A4) No. 11, O'Shaugnessey Road Bangalore, 560 025, India Tel: 91-80-2290061 Fax: 91-80-2290062 Japan Microchip Technology Intl. Inc. Benex S-1 6F 3-18-20, Shinyokohama Kohoku-Ku, Yokohama-shi Kanagawa, 222-0033, Japan Tel: 81-45-471- 6166 Fax: 81-45-471-6122

ASIA/PACIFIC (continued)

Korea

Microchip Technology Korea 168-1, Youngbo Bldg. 3 Floor Samsung-Dong, Kangnam-Ku Seoul, Korea Tel: 82-2-554-7200 Fax: 82-2-558-5934 Singapore Microchip Technology Singapore Pte Ltd. 200 Middle Road #07-02 Prime Centre Singapore, 188980 Tel: 65-334-8870 Fax: 65-334-8850 Taiwan Microchip Technology Taiwan 11F-3, No. 207 Tung Hua North Road Taipei, 105, Taiwan Tel: 886-2-2717-7175 Fax: 886-2-2545-0139

EUROPE

Denmark

Microchip Technology Denmark ApS **Regus Business Centre** Lautrup hoj 1-3 Ballerup DK-2750 Denmark Tel: 45 4420 9895 Fax: 45 4420 9910 France Arizona Microchip Technology SARL Parc d'Activite du Moulin de Massy 43 Rue du Saule Trapu Batiment A - ler Etage 91300 Massy, France Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79 **Germany** Arizona Microchip Technology GmbH Gustav-Heinemann Ring 125 D-81739 Munich, Germany Tel: 49-89-627-144 0 Fax: 49-89-627-144-44 Germany Analog Product Sales Lochhamer Strasse 13 D-82152 Martinsried, Germany Tel: 49-89-895650-0 Fax: 49-89-895650-22 Italv Arizona Microchip Technology SRL Centro Direzionale Colleoni Palazzo Taurus 1 V. Le Colleoni 1 20041 Agrate Brianza Milan, Italy Tel: 39-039-65791-1 Fax: 39-039-6899883 United Kingdom Arizona Microchip Technology Ltd. 505 Eskdale Road Winnersh Triangle Wokingham

Wokingnam Berkshire, England RG41 5TU Tel: 44 118 921 5869 Fax: 44-118 921-5820

01/30/01

All rights reserved. © 2001 Microchip Technology Incorporated. Printed in the USA. 2/01

Printed on recycled paper.

Information contained in this publication regarding device applications and the like is intended through suggestion only and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. No representation or warranty is given and no liability is assumed by Microchip Technology Incorporated with respect to the accuracy or use of such information, or infringement of patents or other intellectual property rights arising from such use or otherwise. Use of Microchip's products as critical components in life support systems is not authorized except with express written approval by Microchip. No licenses are conveyed, implicitly or otherwise, except as maybe explicitly expressed herein, under any intellectual property rights. The Microchip logo and name are registered trademarks of Microchip Technology Inc. in the U.S.A. and other countries. All rights reserved. All other trademarks mentioned herein are the property of their respective companies.

Mouser Electronics

Authorized Distributor

Click to View Pricing, Inventory, Delivery & Lifecycle Information:

Microchip:

MCP120-270I/SN MCP130-270DI/TO MCP130-450DI/TO MCP130T-485I/TT MCP130-460DI/TO MCP130T-485I/SN MCP130-300DI/TO MCP120T-270I/SN MCP130-485FI/TO MCP120T-315I/SN MCP120T-300I/SN MCP130-450I/SN MCP120T-300I/TT MCP120T-315I/TT MCP130T-300I/SN MCP130T-460I/SN MCP120-485HI/TO MCP130T-460I/TT MCP120T-270I/TT MCP130-300I/SN MCP120-450I/SN MCP130T-450I/SN MCP120-485I/SN MCP130T-450I/TT MCP130T-300I/TT MCP130-485DI/TO MCP120-475DI/TO MCP120T-450I/TT MCP120-315DI/TO MCP120T-450I/SN MCP130-475HI/TO MCP130-315HI/TO MCP120-300DI/TO MCP120-460DI/TO MCP120-450DI/TO MCP120-460I/SN MCP130-475FI/TO MCP130-315FI/TO MCP130-460HI/TO MCP130-270HI/TO MCP130-300HI/TO MCP130-450HI/TO MCP120T-460I/TT MCP120-475I/SN MCP130-315I/SN MCP130T-475I/TT MCP130T-475I/SN MCP130-300FI/TO MCP130-460FI/TO MCP130-270FI/TO MCP130-450FI/TO MCP130-475DI/TO MCP130-475I/SN MCP120-270DI/TO MCP120T-485I/TT MCP120T-485I/SN MCP130T-315I/SN MCP130T-315I/TT MCP120-485GI/TO MCP130T-270I/SN MCP120T-460I/SN MCP120-300GI/TO MCP120-270GI/TO MCP120-450GI/TO MCP120-460GI/TO MCP130T-270I/TT MCP120T-475I/TT MCP130-485HI/TO MCP120T-475I/SN MCP120-270HI/TO MCP120-450HI/TO MCP120-300HI/TO MCP120-460HI/TO MCP130-485I/SN MCP130-270I/SN MCP120-485DI/TO MCP130-315DI/TO MCP120-300I/SN MCP120-475HI/TO MCP120-315HI/TO MCP130-460I/SN MCP120-315I/SN MCP120-315GI/TO MCP120-475GI/TO MCP120-475I/SNVAO MCP120T-475I/SNVAO